



**US Army Corps
of Engineers®**

Walla Walla District

LITTLE WOOD, GOODING, IDAHO

INTEGRATED LETTER REPORT AND ENVIRONMENTAL ASSESSMENT

APPENDIX C, HYDROLOGY AND HYDRAULICS CALCULATIONS

This page intentionally left blank.

**LITTLE WOOD, GOODING, IDAHO
INTEGRATED LETTER REPORT
AND ENVIRONMENTAL ASSESSMENT**

APPENDIX C, HYDROLOGY AND HYDRAULICS CALCULATIONS

CONTENTS

1	BACKGROUND.....	C-1
2	CALCULATIONS.....	C-2
2.1	Manning's Equation.....	C-2
2.2	Assumptions.....	C-2
3	COMPARISONS	C-3
3.1	Comparison 1: Typical Section without- and with-Project Conditions.....	C-3
3.2	Comparison 2: Bridge Section without- and with-Project Conditions.....	C-4
3.3	Comparison 3: Slumped/Failed Wall Section without- and with-Project.....	C-6
4	CONCLUSION	C-7
5	SOURCES	C-7

FIGURES

Figure 1.	Ice Jam/Local Flooding Potential	C-1
Figure 2.	Typical Channel Cross Section	C-2
Figure 3.	Typical Two-Lane Bridge Crossing Channel Section	C-2
Figure 4.	Typical Section Comparison.....	C-3
Figure 5.	Bridge Section Comparison 2.....	C-5
Figure 6.	Slumped/Failed Section Comparison	C-6

ACRONYMS AND ABBREVIATIONS

AEP	Annual Exceedance Probability
cfs	cubic feet per second
ft	feet
FEMA	Federal Emergency Management Agency
FIS	Flood Insurance Study
USACE	U.S. Army Corps of Engineers

1 BACKGROUND

To support the feasibility study of the Little Wood River through Gooding, Idaho, some analysis of the current and future without-project conditions will be required. Additionally, some examination of future with-project conditions is necessary. While this project may be able to provide the *potential* for large-scale flood risk reduction, most of the flood risk reduction provided will be very localized.

Gooding has experienced localized flooding, especially in the winter, due to ice jams. The deteriorating nature of the existing wall is causing it to fail in places, which places debris into the channel. This debris becomes a likely site for ice jams to form, and if big enough, may cause local flooding on its own during high flows. The current bridges cause constrictions, which also make them likely candidates for ice jams.

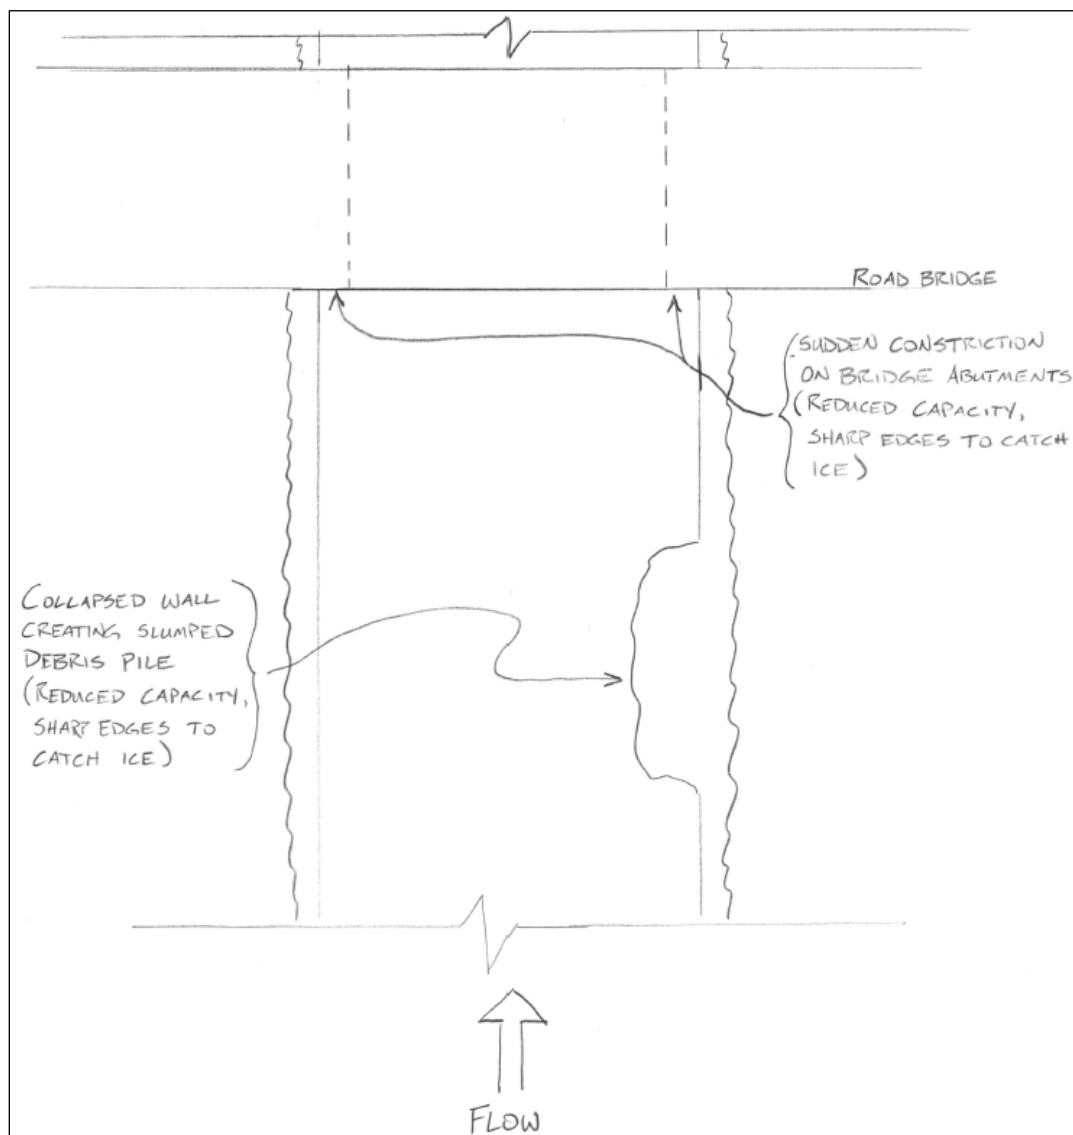


Figure 1. Ice Jam/Local Flooding Potential

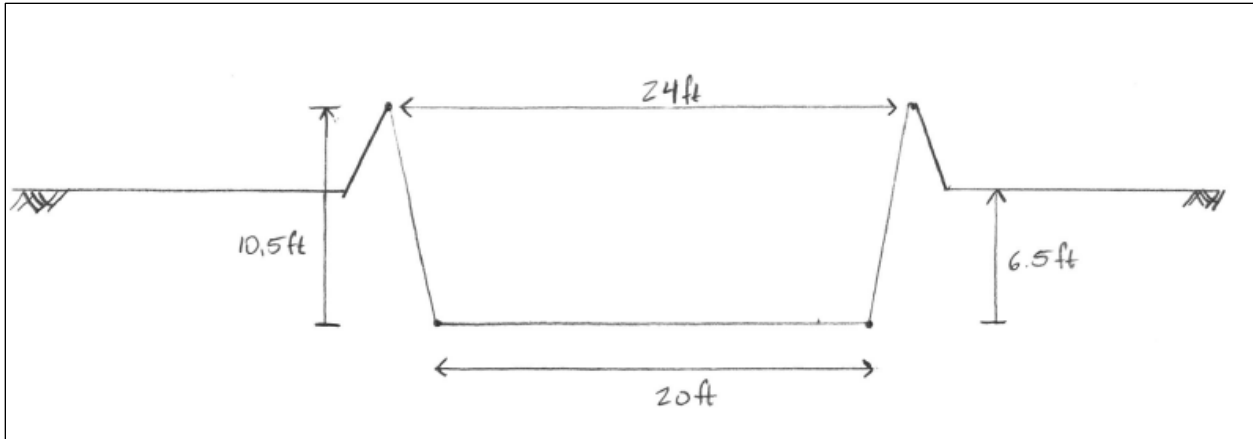


Figure 2. Typical Channel Cross Section

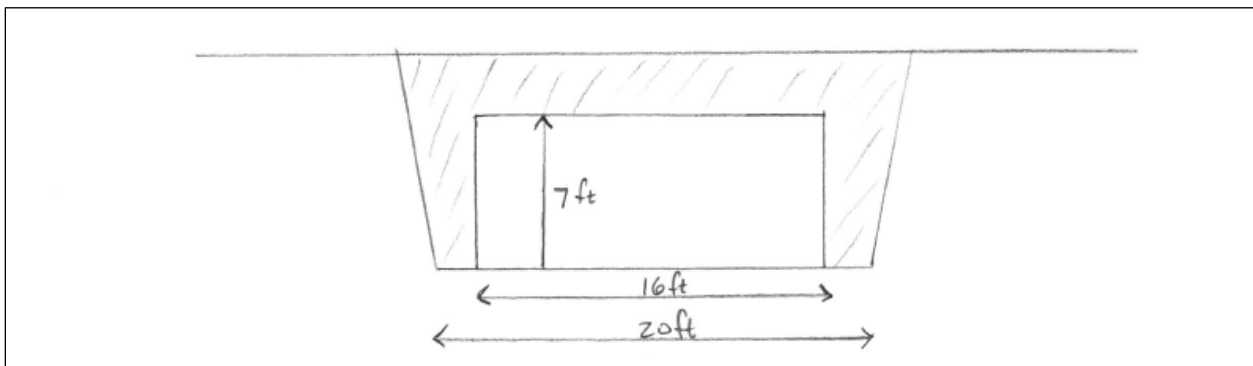


Figure 3. Typical Two-Lane Bridge Crossing Channel Section

2 CALCULATIONS

2.1 Manning's Equation

$$Q = \frac{1.49}{n} AR^{2/3} S_0^{1/2}$$

Manning's Equation can be solved iteratively or through tables to determine the normal depth (y_n) expected from a particular flow, slope, and roughness. That will be the basis largely qualitative analysis.

2.2 Assumptions

Some reasonable assumptions can be carried forward from the City of Gooding Flood Insurance Study (FIS) (FEMA 1985).

The FIS states that the slope of the river in the study area is 6.7 feet (ft) of drop per mile:

$$S_0 = \frac{6.7}{5280} = 0.0013$$

Inside the model, it seemed like the slope was closer to 0.0025 in the built-up section through town.

For flow, the 10 percent Annual Exceedance Probability (AEP) is used.

$$Q = 375 \text{ cfs}$$

(cfs = cubic feet per second)

The hydrology in the FEMA FIS was updated and published in January 2023. The updated 10 percent AEP was reduced to 208 cfs while the 2 percent AEP was increased to 774 cfs. The AEPs for the 1 percent and 0.2 percent AEPs also showed a reduction in peak discharge. This indicates the flood risk associated with the channel has changed since its original construction. The 10 percent AEP from the 1985 FIS is used here as a conservative look at the channel capacity.

Manning's n in the study was set at $n = 0.039$ in the channel. Chow (1959) gives a range of $0.023 < n < 0.035$ for "dry rubble masonry" lining a channel. For "gravel bottom with sides of dry rubble or riprap," Chow suggests $0.23 < n < 0.036$. The FIS value is above these ranges, perhaps better representing the actual degraded conditions.

3 COMPARISONS

3.1 Comparison 1: Typical Section without- and with-Project Conditions

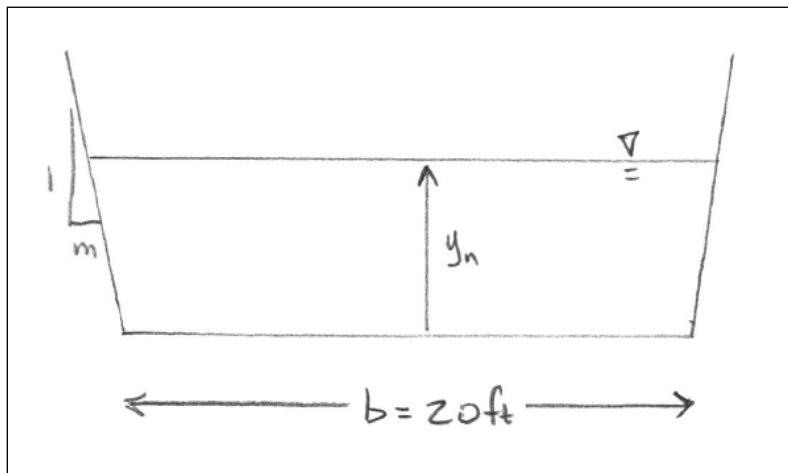


Figure 4. Typical Section Comparison

Without-Project Values

$$m = \frac{2}{10} = 0.2$$

$$n = 0.039$$

Using Table B-1 from Jain (2001), Normal Depth in Trapezoidal Channels

$$\frac{n Q}{1.49 \left(b^{8/3} S_0^{1/2} \right)} = \frac{0.039 (375)}{1.49 (20)^{8/3} (0.0025)^{1/2}} = 0.0667$$

($m = 0.5$)

$$0.0667 \rightarrow y_n/b = 0.21$$

$$0.21 (20) = y_n = 4.2 \text{ feet}$$

With-Project Values:

$m = 0.2$

$n = 0.017$ (concrete)

$$\frac{n Q}{1.49 \left(b^{8/3} S_0^{1/2} \right)} = \frac{0.017 (375)}{1.49 (20)^{8/3} (0.0025)^{1/2}} = 0.0290$$

$$0.0403 \rightarrow y_n/b = 0.10$$

$$0.10 (20) = y_n = 2.0 \text{ ft}$$

All other things being equal, a vast reduction of roughness in the channel will lower the normal depth of a given flow rate. This also means capacity should be increased. Working backwards through the table using the lower n value, what capacity would be available at $y_n = 4.2$ ft?

$$\begin{aligned} 4.2 \text{ ft} / 20 \text{ ft} = 0.21 \rightarrow 0.0667 &= \frac{n Q}{1.49 b^{8/3} S_0^{1/2}} \\ \frac{0.0667 (1.49) (20)^{8/3} (0.0025)^{1/2}}{0.017} &= Q = 860 \text{ cfs} \end{aligned}$$

3.2 Comparison 2: Bridge Section without- and with-Project Conditions

There are some assumptions built into these comparisons. No attempt to examine backwater effects from current bridge crossings will be made. Only capacity at the bridge section will be examined.

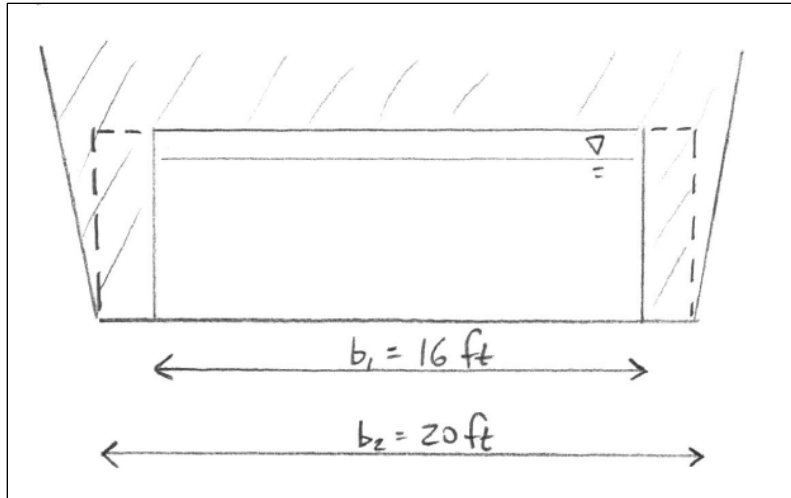


Figure 5. Bridge Section Comparison 2

Without-Project Values

$$m = 0$$

$$n = 0.020 \text{ (older concrete)}$$

Using Table B-1 from Jain (2001), Normal Depth in Trapezoidal Channels

$$\frac{n Q}{1.49 b^{8/3} S_0^{1/2}} = \frac{0.020 (375)}{1.49 (16)^{8/3} (0.0025)^{1/2}} = 0.0619$$

$$(m = 0)$$

$$0.0619 \rightarrow y_n / b_1 = 0.21$$

$$0.21 (16) = y_n = 3.36 \text{ ft}$$

With-Project Values

$$m = 0$$

$$n = 0.017 \text{ (concrete)}$$

Using Table B-1 from Jain (2001), Normal Depth in Trapezoidal Channels

$$\frac{n Q}{1.49 b^{8/3} S_0^{1/2}} = \frac{0.017 (375)}{1.49 (20)^{8/3} (0.0025)^{1/2}} = 0.029$$

$$(m = 0)$$

$$0.029 \rightarrow y_n / b_2 = 0.13$$

$$0.13 (20) = y_n = 2.6 \text{ ft}$$

What capacity might a new bridge section have? $y_n = 3.36 \text{ ft}$

$$\begin{aligned} y_n/b_2 &= 3.36/20 = 0.168 \rightarrow 0.043 = \frac{n Q}{1.49 b_2^{8/3} S_0^{1/2}} \\ \frac{0.043 (1.49)(20)^{8/3}(0.0025)^{1/2}}{0.017} &= Q = 555 \text{ cfs} \end{aligned}$$

3.3 Comparison 3: Slumped/Failed Wall Section without- and with-Project

An assumption is made here about a general shape and size of a slumped/failed wall. No attempt to identify any 3D hydraulic effects of the failed wall is made. Only capacity of the section is examined.

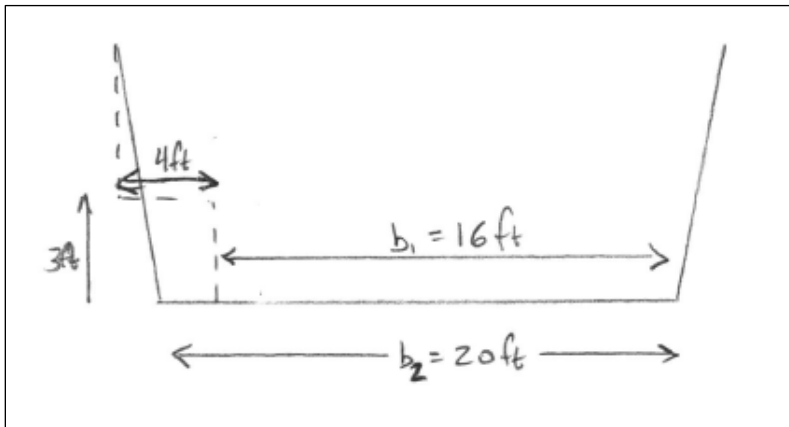


Figure 6. Slumped/Failed Section Comparison

Without-Project Values

$$n = 0.039$$

Simplifying assumption: Assume both sides are vertical ($m = 0$). Up to $y = 4 \text{ ft}$, $b = 16 \text{ ft}$. Using Table B-1 from Jain (2001).

$$\frac{n Q}{1.49 b^{8/3} S_0^{1/2}} = \frac{0.039 (375)}{1.49 (16)^{8/3} (0.0025)^{1/2}} = 0.121$$

$$(m = 0)$$

$$\begin{aligned} 0.121 &\rightarrow y_n/b_1 = 0.30 \\ 0.30 (16) &= y_n = 4.8 \text{ ft} \end{aligned}$$

This is an over-simplification; the real expected y_n will be less than 4.8 ft for a section like this. However, compare this result to those in Section 3.1 The slumped wall raises

the expected y_n from 4.2 ft. The rebuilt section would drop the expected y_n to around 2.0 ft.

4 CONCLUSION

These are all very rough estimates, looking at individual elements of sections with and without the project. The flood risk associated with the channel may have changed since the construction of the channel; however, this exercise illustrates that significant improvements in conveyance capacity will occur with this project. It very likely won't be enough to reduce overall flood risk for the City of Gooding, but it is a significant step in the right direction. More importantly, removing the sudden constrictions at bridges and the slumping failed walls will greatly reduce the potential for ice jams to form. When combined with the capacity improvement from this project, the *localized* flood risks from ice jams and other snags will be meaningfully reduced.

5 SOURCES

Chow, V.T. 1959. Open Channel Hydraulics. McGraw Hill

FEMA (Federal Emergency Management Agency). 1985. Flood Insurance Study, City of Gooding, Idaho.

Jain, S. C. 2001. Open Channel Flow. John Wiley & Sons, Inc.